

Politecnico di Bari

Repository Istituzionale dei Prodotti della Ricerca del Politecnico di Bari

Assessment of landslide damage to buildings at the urban scale

This is a post print of the following article

Original Citation:
Assessment of landslide damage to buildings at the urban scale / Palmisano, F., Vitone, C., Cotecchia, F.. - In: JOURNAL OF PERFORMANCE OF CONSTRUCTED FACILITIES. - ISSN 0887-3828. - STAMPA. - 32:4(2018). [10.1061/(ASCE)CF.1943-5509.0001201]

Availability:
This version is available at http://hdl.handle.net/11589/123451 since: 2022-06-27

Published version
DOI:10.1061/(ASCE)CF.1943-5509.0001201

Publisher:

Terms of use:

(Article begins on next page)

17 November 2026

Manuscript
Click here to download Manuscript ASCE JPCF2017a text rel.13.docx

ASSESSMENT OF LANDSLIDE DAMAGE TO BUILDINGS AT THE URBAN SCALE

Fabrizio PALMISANO, Ph.D. A.M.ASCE[1]; **Claudia VITONE**, Ph.D.[2]; **Federica COTECCHIA**, Ph.D.[3]

[1] Adjunct Professor, DICAR, Politecnico di Bari, Via Orabona 4, 70125, Bari, Italy (corresponding author). E-mail: fabrizio.palmisano@poliba.it

[2] Associate Professor, DICATECh, Politecnico di Bari, Via Orabona 4, 70125, Bari, Italy

[3] Full Professor, DICATECh, Politecnico di Bari, Via Orabona 4, 70125, Bari, Italy

ABSTRACT

This article aims to deepen the knowledge in the field of landslide risk assessment by introducing a new multi-level approach to the vulnerability assessment. It focuses on an original methodology for damage assessment of either masonry or reinforced concrete ordinary buildings at the urban scale. This methodology is an essential part of *Level 1* of the abovementioned multi-level approach. It starts from filling in on-purpose designed forms that are completed when a damage grade is assigned to each building within the region under study, according to a new damage classification. The end-product of the application of the methodology is the so-called the landslide damage geotechnical chart. The chart includes not only the damage grade of the buildings within the urban center investigated, but also the geomorphological and geotechnical maps of the town/area under study, and information concerning the direction of the settlements reconstructed to have caused the damage. The application of the methodology to the historical town of Bovino, in the south of Italy, is also reported.

AUTHOR KEYWORDS

Damage, vulnerability; masonry; reinforced concrete; buildings; landslide.

INTRODUCTION

The assessment of landslide risk is a research topic of spreading interest across the scientific community involved with either geotechnical or structural engineering. This interest stems from the awareness of the still dramatic impact of landsliding on the socio-economic development of vast areas and of the concurrent boosting request for urbanization across landslide prone areas (Ciampalini et al. 2014; Cotecchia et al. 2014, 2015, 2016; Petley 2012). Following the definition given by the United Nations (UNDRO 1979), *Vulnerability* is related to the (potential) results of event occurrence determined through qualitative, semi quantitative or quantitative methods in terms of loss, disadvantage or gain, damage, injury or loss of life.

In this scenario, this article intends to contribute to the advancement of landslide vulnerability assessment, through the provision of a method for both survey and analysis of damage intended to define whether it is caused by landsliding, in particular (although not exclusively) for structures interacting with slow to very slow landslides (Cruden and Varnes 1996; Hungr et al. 2014). The original methodology of damage diagnosis being proposed applies to ordinary buildings, made of either masonry or reinforced concrete, and it has been devised for vulnerability assessment at the urban scale (i.e., a scale classified as medium to large according to Cascini 2008). It has been developed through studies that have been carried out within a four-year research project (PS_119 2007-2010), financed by the Apulia Region (southern Italy) and aimed at the definition of a landslide risk assessment methodology. Such research project has resulted in the Multiscalar Method for Landslide Mitigation (MMLM) validated in the Daunia Apennines as pilot region (Cotecchia et al. 2014, 2015, 2016).

In the following, the damage assessment methodology is first introduced as part of a new methodology for the vulnerability assessment at the urban scale (Palmisano 2011) and,

51 successively, it is explained in detail, with the provision of on-purpose designed survey
52 damage forms to be used for the assessment.
53
54 **MULTI-LEVEL APPROACH TO URBAN SCALE VULNERABILITY ASSESSMENT**
55 At the urban scale, it is both technically impossible and economically inconvenient to perform
56 detailed investigations of the buildings. The complexity of the investigations, the large
57 number and the variety of the vulnerable elements, make it necessary the adoption of a multi-
58 level approach (Palmisano 2016a), from the urban scale to the scale of the single building.
59 The aim is to sort out the vulnerability level of buildings to budget the different intervention
60 options and support the definition of both mid-term and long-term mitigation strategies.
61 The multi-level approach for landslide vulnerability assessment at the urban scale includes the
62 following two levels of analysis (Palmisano 2011):
63 - *Level 1.* The vulnerability assessment at this level can be developed through the work
64 steps reported in Fig. 1 and it covers all the buildings across the area under study.
65 Given the scale of analysis, it should be based on information of easy acquisition, such
66 as general building data (e.g., construction year, structural typology, use), and on the
67 results of visual inspections of the building conditions. The accomplishment of *Level 1*
68 assessment results in: i) the assignment of both a damage grade and a first instance
69 vulnerability grade to each building; ii) the sorting out of the buildings at 'highest
70 vulnerability'.
71 - *Level 2.* This level involves only the buildings recognized as at 'high vulnerability' or
72 at 'high damage' in *Level 1*. A complete structural vulnerability assessment should be
73 carried out, making use of detailed inspections of the buildings, standard and non-
74 standard tests, numerical analyses, strategies for remedial actions. This advanced
75 assessment will also corroborate the interpretation of the landslide damage grades

assigned to buildings in the *Level 1* studies and configures the knowledge for a check of the vulnerability grades proposed.

This article focuses on Step 2 of the *Level 1* approach (Fig. 1) through the outline of an original methodology for landslide damage assessment of ordinary (masonry and reinforced concrete) buildings that can be applied at the urban scale. In the framework in Fig. 1, this Step is preceded by Step 1 that frames the application of 'simple models' (Palmisano 2014; Roca et al. 2011) to interpret the response of buildings subjected to foundation settlements. The simple models are used to back-analyze observed crack patterns and derive the foundation settlement geometry that may have, eventually, caused them. They should be based on fundamental principles of structural mechanics, such as the limit theorems of plasticity, that are valuable at this level, since they afford the description of the essential phenomena controlling the structural capacity (Roca et al. 2011), despite being of relatively simple use. Among this category of models, the Strut-and-Tie Model (Ritter 1899) and the Load Path Method (LPM hereafter; Schlaich et al. 1987) have been successfully used for long time to analyze reinforced and pre-stressed structures. By using the LPM, it has been possible to define the most recurrent typologies of crack patterns that affect ordinary buildings subjected to foundation settlements (Palmisano 2016b; Palmisano and Elia 2013, 2015). In Fig. 2 some examples of simple crack patterns and damages to masonry and R.C. buildings due to foundation settlements are shown. For more complex cases of LPM applications see also Palmisano (2016b).

The *Level 1* methodology (Fig. 1) makes use of the characterization of the crack patterns such as those in Fig. 2 to discern if the damage is due to foundation settlements. Moreover, it should be noted that the back analysis of the crack patterns through LPM makes it possible to derive also the settlement direction (Fig. 2). This information, when collected for several buildings in the urban area, can be of use to recognize the morphology of a landslide body,

101 even when landslide features are hidden by urbanization or are unclear.
102 The damage assessment at the urban scale (Step 2, *Level 1* in Fig. 1), that is the main object of
103 the present article, aims to provide rapid and objective data that, together with the
104 geomorphological and the geotechnical ones, are fundamental for both the diagnosis of the
105 landslide damage distribution across the territory and the vulnerability assessment (i.e., Step
106 3). This Step may be very useful in urban areas also to acquire indirect evidence of landslide
107 activity, otherwise of difficult detection solely on geomorphological basis.
108 The third part of the proposed methodology (Step 3 in Fig. 1) benefits from the results of the
109 previous steps and aims to assess the *Level 1* structural landslide vulnerability at the urban
110 scale. In particular, the geometry and the structural and historical data about the buildings,
111 acquired in Step 2, are used as input data for the evaluation of structural vulnerability,
112 whereas the damage data are useful at this step to further support the characterization of
113 landslide-structure interaction. This part of the methodology will be covered in a forthcoming
114 article.
115 It is worth noting that the vulnerability assessment methodology here proposed is significantly
116 different from other approaches present in the literature, which, most often, account for purely
117 qualitative damage analyses (e.g., Liu et al. 2002; Cardinali et al. 2002; Leone et al. 1996),
118 often for specific landslide events. Indeed, the studies of landslide vulnerability of structures
119 are few, probably because they require multidisciplinary research work, in both structural and
120 geotechnical engineering. Only recently structural vulnerability assessment has been included
121 in natural hazard and risk analyses, although seldom for landslide risk. For landslides,
122 vulnerability has been assessed mostly through the use of empirical fragility curves, derived
123 from the qualitative survey of structural damage (e.g., Uzielli et al 2015; Peduto et al. 2017a,
124 b). The qualitative analyses, though, result in curves that account only for the grade of
125 structural damage, irrespective of the type of damage and of its correlation with the direction

of the foundation settlement causing that damage. Hence, it is evident the need for a new procedure that, starting from the mechanical analysis of the structural behavior of a building, evaluates the potential damage that it may undergo when subjected to foundation settlements due to landsliding.

To this aim, the proposed methodology is fully deterministic and based on the strong coupling between the geomorphological and the geomechanical knowledge of the landslide mechanism and the structural behavior of the interacting building. Its starting point (Step 1) is the interpretation of the structural behavior of a building subjected to foundation settlements (e.g., Palmisano 2016). The main aim is to strictly correlate the damage with the structural response and, hence, with the relevant foundation settlement. As shown in the following, such deeper investigation of the structural behavior is thought to be extremely useful to support geotechnical and geological studies for stability analyses in urbanized areas.

In the following, after a brief review of the classifications of structural damage reported in the literature, a new landslide damage classification of buildings is proposed (Phase 2.1 of Step 2, Fig. 1) and the survey methodology to acquire the data of use in the assessment is outlined in detail (Phase 2.2 of Step 2, Fig. 1). Thereafter, the application of Steps 1 and 2 of the methodology (Fig. 1) is presented for the town of Bovino in the Daunia Apennines (southern Italy).

LANDSLIDE DAMAGE ASSESSMENT AT THE URBAN SCALE

Key features of the methodology

As shown in the framework in Fig. 1, the proposed methodology starts with the definition of a new classification of reference for the damage assessment (Phase 2.1). This draws inspiration from the most relevant classifications of structural damage due to foundation settlements

151 reported in the literature, which, though, have never been related to landslide effects.
152 On-purpose in-situ surveys should result in the filling in of original damage forms that, as
153 discussed in the following, have been designed both to gather sufficient data to recognize if
154 damages stem from foundation settlements and to assign, to each building, a damage grade
155 within the new damage classification. Such recognition can be pursued by using the 'simple
156 models' selected in Step 1 in Fig. 1, e.g., the Load Path Method. Through these models the
157 damaged buildings most likely damaged by foundation settlements (Palmisano 2016b) will be
158 selected. The third phase of Step 2 entails the mapping of damage with the indication of the
159 foundation settlement direction that has been reconstructed to be the cause of the damage
160 (except for the buildings whose damage is not related to foundation settlements). The damage
161 map (see Phase 2.3 in Fig. 1) will also contain the damage grades assigned to the buildings
162 and the geo-morphological features of the landslide processes and indications about their
163 kinematics, as resulting from geo-morphological and geotechnical studies. Through such
164 multi-theme mapping, it is derived what here defined as the 'landslide damage geotechnical
165 chart' of the urban area. This represents the ground of comparison between the settlements
166 diagnosed as cause of the building damages and the landslide induced ground settlements.
167 From such comparison, the features and grade of damage that landsliding is causing to the
168 buildings, given their structural features, is diagnosed. Such evidence is the starting point for
169 the physically based modelling of the landslide effects at the urban scale and, hence, for the
170 *Level 1* vulnerability assessment, to be developed in Step 3 (Fig. 1). Hence, this article aims to
171 fill the gap in the literature by introducing a tight link between landslide geomechanics and
172 structural damage mechanics. This is why the proposed methodolgy can be considered as
173 systematically applicable to survey structural damage due to landslides.
174 The methodology has been prompted by the study of landsliding in urban centers where
175 landsliding is peculiarly slow, so it benefited by this particular circumstance, although it is

176 applicable also to other landslide conditions/activity.

177

178 **Building damage classification**

179 According to Burland (1997), the assessment of thw degree of building damage can be a
180 highly subjective. It may be influenced by a number of factors such as experience, the attitude
181 of insurers, the cautious approach of a professional engineer or surveyor who might be
182 concerned about litigation, market value and 'saleability' of the property. This is why the
183 availability of a classification of damage is a key issue for a correct development of
184 assessment of the causes of building damages.

185 Burland et al. (1977), starting from previous studies, proposed a classification of damage for
186 foundation settlements based on the features of the damage affecting walls and making
187 reference to the ease of its repair (i.e., plaster, brickwork and masonry). In this classification,
188 six categories of damage of increasing severity have been identified.

189 After Burland et al. (1977), Alexander (1986) proposed an intensity scale for structural
190 damage caused by subsidence, compression, or extension of the ground during landslides. The
191 classification was developed based upon field surveys of the 1982 Ancona landslide (Italy).
192 He characterized the building conditions by adapting post-earthquake building inspection
193 forms, used in Italy at that time, to inspect the landslide effects.

194 Later, the classification of building damage by Leone et al. (1996) distributed the damage
195 grade between 0 and l, to represent the degree of loss of the element. With sufficiently
196 detailed diagnostic analyses, the progression of damage from 0 to 1 could result in the
197 calculation of the loss rate.

198 Benefiting from these published experiences in damage surveying and classification, as well
199 as from the most developed experience in damage surveying provided in earthquake
200 engineering by using the European Macroseismic Scale 1998 (EMS-98 hereafter; Grüntal

1998), a new building damage classification has been developed, with the specific aim to address it to landslide damage assessment at the urban scale.

The original classification proposed in the following has mainly taken inspiration from the EMS-98 because it represents the most widespread and tested damage classification in the field of structural engineering. However, since the proposed classification cannot be solely limited to damages induced by seismic actions, many modifications at the original EMS-98 were needed. Moreover, given the objectives of the *Level 1* assessment (Step 3; Fig. 1) at the urban scale, the new damage classification reports elements useful to characterize the landslide structural vulnerability (Step 3 in Fig. 1) and, to this aim, it merges some issues from Burland et al. (1977) and Boscardin and Cording (1989) classifications with the classification from EMS-98 (Fig. 3). The classification here proposed (Fig. 4), hence, derives from the original combination of both structural experience in the seismic field (EMS-98) and geotechnical experience in tunneling excavation (Burland et al. 1977), significantly revised and completed by the experience in the landsliding field. This is why the proposed classification can be considered as new. Moreover, the strict correlation between this classification and other ones present in the literature (mainly EMS-98 and Burland et al. 1977; see Fig. 3) makes it also possible the comparison between new data (resulted from the application of the proposed methodology) and those coming from old databases and that ordinarily exist only in a scattered form.

The proposed classification is reported in Figs. 3 and 4; it defines six grades of damage, from 0 to 3c, as the severity of the damage increases. Grades 0 and 1 relate to serviceability limit state, grade 2 to serviceability/ultimate limit state, grade 3a, 3b and 3c refer to ultimate limit state, ultimate limit state/collapse and collapse, respectively. As it can be noticed from Fig. 4, each grade of damage depends not only on its level, but also on its extension.

Differently from the classification by Burland et al. (1977) and from others that deal with

226 foundation settlements (e.g., Cooper 2008), the proposed classification introduces quantitative
227 descriptions of both the level and the extension of the damage (Fig. 4) to have an evaluation
228 of the damage grade as objective as possible trying to reduce at the minimum the subjective
229 interpretation of the surveyor.
230 The choice of the damage grade should always be on the safe side (i.e., focusing on the worst
231 condition). For example, for a building with both 'damage level 2 in few elements' and
232 'damage level 3 in few elements', since the latter corresponds to the higher damage grade 2,
233 this grade should be assigned.
234
235 **1st level damage survey forms and diagnosis of the damage patterns**
236 The issue of using standardized damage forms to characterize the conditions of building
237 interacting with landslides mainly follows the examples from Alexander (1986) and the
238 procedure adopted by the Italian National Department of Civil Protection (DPC 2009) for the
239 immediate assessment of aftermath damage caused to buildings by seismic events.
240 The surveyors can fill in the damage forms after direct and rapid site surveys (i.e., only visual
241 inspections). The aim is to obtain the most possible objective description of the features and
242 the damages of the building, devoid of any subjective interpretation of the surveyor.
243 The forms are designed to detect typological features and damage characteristics of either
244 ordinary masonry or reinforced concrete buildings. Therefore, these forms are not applicable
245 to 'non-ordinary' buildings, such as theatres, churches, sports facilities, industrial buildings. It
246 is worth highlighting that, although the methodology being proposed has been defined with
247 reference to slow-moving landslides, these forms can also be used in the immediate aftermath
248 of rapid landslides.
249 The damage survey forms for ordinary buildings are reported in the Supplemental Data of the
250 online release of this article. They are composed by the following sections:

- Section 1: building identification.
- Section 2: building description.
- Section 3: structural typology.
- Section 4: damage to structural elements and partition walls, existing emergency measures.
- Section 5: damage to non-structural elements (partition walls excluded) and existing emergency measures.
- Section 6: external danger and existing emergency measures.
- Section 7: further notes.
- Section 8: damage grade.

Sections 1, 2, 5-8 are identical for both masonry and R.C. buildings.

It is worth noting that even if the forms here proposed have been inspired by those by DPC (2009), they can be considered as completely different from them mainly for the following reasons:

- The aim of DPC (2009) forms is to give a quick and temporary judgement about the usability of a damaged building in the aftermath of an earthquake; hence, they include very few data about the building and its damages. The aim of the proposed form, instead, is to detect typological features of the building as well as to give detailed information about damages in order to detect and monitor landsliding in urban area.
- The DPC (2009) forms, in the damage section, include only crack patterns due to seismic actions while the proposed forms provide data about any damage feature, not only associated to foundation settlements.
- To fill in the damage section of DPC (2009) forms, the judgement of the surveyors is needed in order to evaluate if the observed damage is caused by the earthquake. On the other side, to fill in the damage section of the proposed form no judgement is needed to

evaluate the cause of the damage since the aim of this section is to detect all kind of damages.

- Section 8 of the proposed form is completely new and it is the result of the Step 1 (Fig. 1) of the proposed methodology.

Moreover, it is worth noting that the proposed forms can be also considered as new since, in the literature, nothing similar appears to be proposed, especially, with reference to the damage section and to the correlation between damages and foundation settlement by using a structural mechanics approach.

Before starting the survey, general information about the building should be acquired, e.g., from the Technical Office of the Municipality, the owner, people involved in the construction and/or in the maintenance and building management. This information should concern the year of construction, the used materials, the possible modifications, enlargements and damages over the years, etc. In the forms, circle boxes are used for a single choice, while square boxes for multiple choices.

In Section 1 the grey area concerns information that may be partly given by the Technical Office of the Municipality, while the white areas indicate fields that must be completed by the surveyor. The grey area of Section 1 is consistent with the current Italian Codes; obviously, if the form is used in another Country, the grey area should be updated accordingly. The 'building location' refers to its position inside a block of buildings, while the 'use code' is relevant to public services and it is the same as that given by DPC (2009).

In Section 2, the most important data about the building should be collected: dimensions, age, current usability, type of use and ownership, etc. It is worth noting that data to be collected in the forms should be easily found out by visual inspections. In this respect, the age of the building is a non-robust piece of information, as it can be obtained only by means of interviews, either of the owners or of the tenants of the building. The 'construction age'

periods indicated in the forms are relevant to the most important changes in the Italian technical standards. If the form is used in another Country, the 'construction age' periods should be updated accordingly.

The structural typology should be defined in Section 3, through an array where the rows contain the typologies of horizontal structures (roof excluded) and columns those of vertical structures. It is also possible the multiple-choice option, that is useful to describe buildings including different typologies of both horizontal and vertical structures.

Buildings are considered made of reinforced concrete if the entire elevation bearing structure is in reinforced concrete. If in the same building there are both masonry and reinforced concrete vertical bearing structures, the column *M* in Section 3 of the masonry building form should be filled in. In particular: box *M1* should be marked if the vertical R.C. structure is limited to the upper floor, while all the other floors have masonry vertical structures; box *M2* should be marked if the vertical R.C. structure is limited to the lower floor, while all the other floors have masonry vertical structures; box *M3* should be marked if on the same floor there are both vertical R.C. and masonry structures, or if there are some floors with vertical R.C. structures and others with vertical masonry structure (cases *M1* and *M2* excluded).

In the masonry building form (Section 3), the possible presence of isolated columns (R.C., masonry, steel, wood) should be indicated in column *L*, whereas for 'strengthened' masonry, column *N* should be optioned. In particular, the following boxes should be marked: *N1* if the masonry has been strengthened by reinforced or unreinforced injections or by reinforced plaster; *N2* for masonry that has undergone other strengthening systems.

Regarding masonry composed by artificial units (columns *E*, *F*, *G* in Section 3 of the masonry building form), solid units are those having hole percentage not higher than 15%, perforated units from 15% to 45% and hollow units higher than 45%. Without in-situ tests, it is quite impossible to understand the unit typology. Hence, in this case, the surveyor team should

select the type of worst performance (i.e., hollow units), provided that this choice is declared in Section 7. Section 3 of the forms is completed by a matrix concerning the roof structure typology.

Sections 4 and 5 concern the damage of structural and non-structural elements and the existing emergency measures. These sections are the most innovative, since they strongly differ from those of the forms by DPC (2009). While the latter include only crack patterns due to seismic actions, the proposed forms can provide data about any damage feature, not only associated to foundation settlements. This is because the aim of this section is to minimize the subjective judgment of the surveyors about the cause of the observed damage.

The damages of the structural elements and of the partition walls are in the same group, that is different from that of damages to other non-structural elements. This is of particular importance for R.C. structures, for which architectural components often hide moderate damages and, hence, the assessment of damages of non-structural elements is the only way to evaluate the damage grade of the building by using only visual inspections.

The assessment of the damage extension must be carried out separately for each row with reference to the entire building (if the inspection is partial, the damage extension is referred to the part of the building that has been inspected).

In the Supplemental Data of the online release of this article, the most significant typologies of cracks indicated in Section 4 of the forms are shown in order to support the surveyor team to correctly fill in this section of the forms.

At the end of Sections 4 and 5, the presence of existing emergency measures should be indicated. If, according to the surveyor team, further emergency measures should be adopted, they could be indicated in 'further notes' in Section 7.

Section 6 deals with external danger and existing emergency measures. External danger may arise from the instability of neighboring buildings (danger of collapse or falling objects) or

351 even from the unsafety of distribution networks.
352 In the first part of Section 7, information about the accuracy of the survey has to be given.
353 The second part of this section is dedicated to free notes, sketches and/or further comments
354 about the degree of reliability of the gathered information.
355 In Section 8 the surveyor should indicate the damage grade of the building, by selecting it
356 from the damage classification proposed in Fig. 4. Since the damage description is prescribed
357 to be very detailed in the forms, this last step can be solely based on a careful analysis of all
358 the data introduced in the dedicated sections. In emergency conditions, the classification of
359 the specific building damage grade derived in Section 8 will allow to establish which
360 buildings are either usable, or usable only after emergency measures, or not usable.
361 As mentioned in the previous paragraphs, the proposed classification introduces quantitative
362 descriptions of both the level and the extension of the damages (Fig. 4) to have an evaluation
363 of the damage grade as objective as possible trying to reduce at the minimum the subjective
364 interpretation of the surveyor. It is worth highlighting that while this is an appropriate aim, it
365 realistically cannot be fully achieved. Human subjectivity will always be a factor (Terwel and
366 Jansen 2015; Terwel 2017), and must be considered by the recipients of the final document
367 (i.e., landslide damage geotechnical chart) of this methodology. Subjectivity can have both
368 negative and positive effects. In order to reduce negative effects such as emotional bias and
369 surveyor fatigue, it is auspicial that an experienced structural engineer help the surveyor team
370 to fill in Section 8 of the forms.
371 The second part of Section 8 deals with the possible causes of the damage. To this aim,
372 according to the approach proposed (Step 1 in Fig. 1), the surveyor team becomes able to
373 assess whether the damage is caused by foundation settlements. If this is the case, the
374 corresponding box should be marked and a sketch of the building plan also providing
375 indication of the direction of the settlement causing the damage is to be provided. This sketch

should be done only when it is possible to associate, in an objective way, the observed damage with the direction settlement. In the Supplemental Data of the online release of this article the graphic lexicon to indicate, on the building plan, the pattern of differential building settlements is shown. This lexicon applies to buildings whose cracks are evident along the boundary walls. When the damaged portion is inside, the arrows indicative of the settlement direction should be drawn inside the perimeter of the building plan. In Section 8, the box 'undecided' can be used either if the surveyor team is not sure if the damage is due to foundation settlements or if it can be ascribed not only to foundation settlements.

At this stage of the analysis, it cannot be assessed yet if the foundation settlement has been caused by either landslide movements, or intrinsic structural defects of the building (e.g., under-dimensioning of the foundations). To this aim, the structural survey will have to be put in a more general survey context, also implementing the results of the geomorphological and geotechnical studies of the slopes interacting with the buildings.

The landslide damage geotechnical chart

The experience gathered in urban areas has shown that within these areas the detection of landslide activity cannot rely solely on multiple-year analysis of topographic maps and aerial photos and in-situ geomorphological surveys. Rather, the use of topographic monitoring, either through on-site equipment, or through satellite monitoring (e.g., GPS, DInSAR, PS-INSAR), of equipment to monitor underground displacements (e.g., inclinometers), is crucial (Cotecchia et al. 2014, 2015; Ciampalini et al. 2014; Peduto et al. 2017). Furthermore, very recent experience is showing how the combination of these data with the results of building damage surveys is guaranteeing more successful assessments of landslide activity.

The integration of topographic, geological, geomorphological and geotechnical survey data, along with the results of geotechnical modelling of the equilibrium of the landslide bodies

401 (e.g., through limit equilibrium) and of the slope stress-strain conditions (e.g., through
402 numerical modelling), represent, on the whole, the database characterizing the ground
403 movement conditions. Their comparison with the ground movements inferred to cause
404 building damages, as result of the Step 2 analyses discussed above, may result in: as first, the
405 assessment of the causes of the building damage (of whether it is caused by landsliding);
406 consequently, also in an improvement of the characterization of the landslide activity. Hence,
407 the last phase of the damage assessment (Phase 2.3 of Step 2 in Fig. 1), entails the
408 implementation of the building damage maps and of the arrows indicative of the settlement
409 geometries within a map reporting the topographic features of the area and the database
410 quoted above as providing the characterization of the landsliding. The result of such
411 implementation will be defined as the 'landslide damage geotechnical chart', i.e, the end-
412 product of both Steps 1 and 2 of the *Level 1* assessment (Fig. 1).
413 This chart should include the geomorphological map of the urban area under study,
414 indications about the kinematics of the landsliding, the damage grade of all the buildings for
415 which damage appears to depend on foundation settlements, as well as the direction of the
416 settlements causing the damage (according to Section 8 of the damage forms).
417 It is worth noting that the information about the settlement direction that has caused the
418 observed damage can be considered as an innovative aspect of the methodology since similar
419 charts present in the literature (even if based on different approaches and classifications)
420 contains only information about the damage grade.
421 To assess whether the damages of the buildings are connected to landsliding, it is then
422 required a careful comparison of the building foundation settlements, the settlements that the
423 landslide mechanism is expected to generate and any other settlement expected to occur due
424 to other causes. To this aim, the representation of the settlement direction in the proposed
425 chart appears to be useful to support the identification of both the contours of the landslide

426 body and the direction of the landslide movement.

427

428 **APPLICATION OF THE METHODOLOGY TO THE TEST SITE**

429

430 **Geomorphological and geotechnical setting**

431 One of the pilot test sites of application of the building damage assessment procedure
432 presented has been the town of Bovino (647 m a.s.l.), in the Daunia Apennines, where also
433 the Multiscalar Method for Landslide Mitigation, MMLM, has been validated (Cotecchia et
434 al. 2016; Cafaro et al. 2017).

435 As for most of the urban centers in the Daunia Apennines, it lies on a promontory whose
436 slopes are location of several ancient slow-moving landslides that have, ever since, affected
437 the economic development of the town. As discussed in some detail by Cotecchia et al. (2014,
438 2015) and Cafaro et al. (2017) most of the landslides are roto-translational, from medium
439 depth to deep and from very slow to slow. The geo-morphological map of the southern
440 portion of the town is shown in Fig. 5. The toes of the larger landslides emerge along the river
441 Biletra located at the bottom of the valley. The landslide activity is often made evident by
442 cracks visible on structures and infrastructures located upslope, about the landslide rear
443 scarps, whereas bulging is frequently noticed during spring, within the lower-middle portion
444 of the unstable slopes.

445 The Apennine sector where Bovino is located is mostly made up of Meso-Cenozoic tectonic
446 units (Sannio, Fortore and Daunia Units), that include turbiditic formations, in which
447 limestones and sandstones are found interbedded with clayey strata. In particular, at Bovino
448 the Faeto Flysch outcrops across the whole promontory, from North to South (Fig. 5). Only
449 the old part of the town is founded on the Synthem of Bovino, a sequence of conglomerates
450 interlayered with medium-coarse arenaceous strata. In general, the tectonic events have

451 modified the original sedimentary set-up of the geological formations and often even the soil
452 micro- to meso-structures (Nardelli et al. 2016; Silvestri et al. 2007; Vitone and Cotecchia
453 2011; Vitone et al. 2013a,b; Cotecchia et al. 2014). Consequently, at Bovino the clays may be
454 locally found to be fissured and, in general, the rock strata are fractured and float as
455 disarranged rock masses within the fine soils (Cotecchia et al. 2015).
456 The Pianello suburb, in the south-western part of the town, is location of the highest
457 concentration of landslides and of the most relevant damages to structures. The largest one,
458 i.e., body A in Fig. 5, extends from the top of the Pianello slope, where its main scarp almost
459 overlaps the slope crest, to the toe of the slope, at the Biletra river. The geotechnical model
460 has been derived on the basis of laboratory tests (physical characterizations and mechanical
461 tests, i.e., oedometers, consolidated undrained triaxial tests, Bromhead ring shear tests) carried
462 out in the laboratory on undisturbed samples taken down three boreholes during the in-situ
463 campaign of the four year research Project PS_119 (Cotecchia et al., 2016). The experimental
464 investigation allowed for the characterization of the weakest portion of the Faeto Flysch (FAE
465 in the following), i.e., mainly clays of both medium to high plasticity (PI ≅ 35-55%) and
466 activity (A ≅ 0.8-1.1) of rather poor strength (peak parameters: $c'_{min-max}$ = 0-25 kPa, $\phi'_{p\ min-max}$
467 = 13°-26°; residual strength, Bromhead ring-shear: ϕ'_r = 8.5°).
468 Only in its north-eastern portion, about the eastern side of the rear scarp, body A (Figs. 5 and
469 6) involves the FAE unit richer in calcareous strata. Although interbedded with the clayey
470 strata, the strength of these strata allows for a local higher steepness of the slope. Body A has
471 been recognized to be a deep slow compound roto-translational slide, according to
472 inclinometer monitoring (e.g., I2 readings in Fig. 5b), which has provided evidence to a
473 currently active slip surface at 47 m depth. This body was already present in late 1800 and it
474 is currently active in late winter –mid spring, with rates of about 2cm/year. Both bodies B-D

475 (Fig. 6) are medium-deep clay-slides; body B has been assessed to be of 25 m maximum
476 depth, based upon inclinometer monitoring and limit equilibrium back analyses.
477 As often observed in the Daunia Apennine, also in the town of Bovino the weakness of the
478 clays in the slopes is connected to their high plasticity and to fissuring (Cotecchia et al. 2014)
479 and it is one of the main factors predisposing the slopes to landsliding. At Pianello, the trigger
480 of landslide A was most probably a deforestation taking place in mid 1800. At present, this
481 body is moving very slowly along a deep shear band, where the operational friction angle is
482 about 15°. Another internal factor that predisposes body A to sliding is the piezometric
483 regime, that is characterized by very high piezometric heads down to large depths. The trigger
484 of current reactivation of sliding for body A has been found to be the seasonal variation of the
485 pore water pressures within the slope (Cotecchia et al. 2014), that has been monitored by
486 means of piezometers installed from small to large depths (e.g., piezometers down P1, P2 and
487 P3 in Fig. 5). It seems that these variations make body A be mainly quiescent in summer and
488 active from mid-winter to mid-spring. Body B is in interaction with Body A, since it overlaps
489 body A at its top-east portion, i.e., the steeper portion of the hillslope due to the intensifying
490 of rock interbedding strata. It is among the most active landslides in Bovino and occurs in one
491 of the portions of the town where building damage is most frequent, as discussed in the
492 following.
493
494 **Landslide damage assessment**
495 As recurrently observed in the urban centers of the Daunia Apennines, the Bovino historical
496 centre benefits from being founded on the most stable outcropping, here represented by the
497 Synthem, a formation of cemented conglomerates (Cotecchia et al. 2014). The most recent
498 urbanization, instead, has usually compelled the founding of buildings on the clay
499 outcroppings and, in the case of Bovino, the new town is founded not only on high plasticity

clay outcroppings of FAE, but also on soils either part of the landslide bodies shown in the map (Fig. 5), or in interaction with the landslide bodies (e.g., back of the rear scarps). As in Bovino, other common feature among the urban centers within the Daunia Apennines is the major concentration of the building damages in the depletion zones of the landslides. This seems to occur despite the different structural typologies of the buildings that, in Bovino, are mainly represented by:

- Masonry buildings: 2-3 floors; masonry vertical structures; vaults and/or composite beams (R.C. or steel) - blocks or wooden floors as horizontal structures.
- R.C buildings: 3-8 floors; R.C., composite beams (R.C.) - blocks as horizontal structures; isolated footings or strap footings or beams as foundations.

The results of the *Level 1* analyses of both Steps 1 and 2 for Bovino are mapped in the landslide damage geotechnical chart shown in Fig. 6. As result of the application of the methodology, this chart reports not only the damage grade of the buildings, but also the information concerning the direction of the settlements (arrows in the chart) reconstructed to have caused the damage through the diagnosis of the crack patterns carried out by means of the Load Path Method. The chart in Fig. 6 includes the damage grade only for those building that, according to Section 8 of the forms, resulted to be damaged by foundation settlements. In Fig. 7 some typical damage observed in Bovino are shown (the building numbers refer to those indicated in Fig. 6).

It is worth mentioning that landslide contours indicated in Fig. 6 are updated to 2010 (taking account also of the preliminary results, at that time, of the damage assessments) so that they are slightly different from those, less recent, in Fig. 5. Conversely, the damage grades and the settlement directions, as above-mentioned, are updated to the surveys performed in 2013.

The surveys were performed by teams composed of three people (i.e., a structural engineer, as leader, and two students of Master of Engineering Courses); they were carried out between

2008 and 2013 and included all the buildings located in Bovino. The surveys cannot be considered fully exhaustive because the surveyors could not enter many buildings and because buildings were restored/repainted during the damage monitoring and crack patterns were hidden for long. For the last reason, some surveys had to be repeated 2-3 times. Among the buildings reported as damaged in Fig. 6, the surveyors could enter only those marked with the asterisk '*' in the figure. No documentation was given by the municipality and, hence, general data of the buildings were acquired by interviewing the inhabitants. If the survey was limited to the external part of the buildings, it was possible to fill in about 20-25 forms per day. For complete surveys, instead, the time spent to fill in the forms depended on the dimension of the building (never more than one hour per building).

Among the damaged buildings in Fig. 6, those numbered as 10-13, 15-18, 23-24, 27 have R.C. structure while the others have masonry structure. Moreover, buildings 10-12, 15-17, 23 are public while the others are residential buildings. At the time of the surveys, buildings 16-17, 20, 26 were declared unusable by the municipality while in building 12 some retrofitting works were in progress.

According to recent information obtained by the Technical Office of the municipality, after 2013 some of the most damaged buildings in Fig. 6 were retrofitted (buildings 11 and 17), declared unusable by the municipality (buildings 8 and 15) or demolished (20 and 26). It should be specified that the retrofitting carried out on buildings 11 and 17 regarded only seismic actions and not differential settlements induced by landsliding.

Moreover, some further information about buildings 24-26 should be added. They were originally built with masonry structure in the 1960s as part of a lot of seven identical buildings. In the 1990s, because of damages due to foundation settlements, two of them (the building 24 and that between this one and building 26 in Fig. 6) were demolished and rebuilt with R.C. structure. This is noteworthy since building 24, even if recently rebuilt with a

550 different structural typology, is again exhibiting crack patterns relevant to foundation
551 settlements.
552 The landslide damage geotechnical chart (Fig. 6) shows that most the damaged buildings is
553 located either at the back or within the crown area, or on the lateral borders of the landslides.
554 It follows that buildings located within the landslide body are likely to be mainly subjected to
555 'rigid-body' displacements, so that they do not exhibit any damage.
556 The chart shows that, except for one case (i.e., the building 13 in Fig. 6), all the buildings
557 have shown crack patterns typical of lateral settlements. Even if this aspect requires further
558 investigation, a preliminary interpretation is proposed in the following. As mentioned above,
559 most of the damaged buildings are located either in the crown area or on the lateral borders of
560 the landslides. This means, firstly, that differential settlements within the landslide body are
561 not so large to produce structural damages. The main reason of this could be that building
562 dimensions are negligible with respect to the landslide settlement shape and, hence,
563 differential settlements are negligible. This consideration does not apply to the borders of
564 landslides where, in general, high values of differential settlement have been observed.
565 Moreover, on the borders a 'hogging' landslide settlement shape is activated, which could
566 justify why only crack patterns due to lateral settlements have been observed in Bovino (i.e.,
567 typologies a-d and l of Fig. 2). The central settlement damages observed in the internal part of
568 building 13 (Fig. 6) can be, hence, suspected to be due to intrinsic structural defects of the
569 building (e.g., under-dimensioning of the foundations of the internal columns).
570 In some cases, the landslide damage geotechnical chart (Fig. 6) shows a strict correlation
571 between the settlement direction and the main landslide movement (for instance see buildings
572 6, 11-12, 20, 23, 28 in Fig. 6). Moreover, when buildings are located on the lateral borders of
573 the landslides some torsional movement is testified by the crack patterns (e.g., buildings 16-
574 18, 26 in Fig. 6).

As said before, landslide damage assessment at the urban scale may be very useful as indirect evidence of landslide activity in urban areas, since the assessment of landsliding in such urbanized contexts may result to be not easy if based solely on geomorphological studies.

At Bovino, the landslide contours in the chart in Fig. 6 result from geomorphological studies carried out up to 2010, whereas the structural damages are updated to 2013. This discrepancy in time clearly emerges from some discrepant results reported in the landslide damage geotechnical chart (Fig. 6). In particular:

- settlement directions of buildings 24-25 seem to suggest that these buildings should be included in the crown of the landslide body L;
- settlement direction of the building 23 shows that the crown contour of landslide C1 should be moved further south-east;
- according to settlement directions of the buildings 21-22 the crown contour of landslide body L should be moved further south-east and, hence, landslide C4 should be eliminated or its contour should be modified (e.g., moved further south-east);
- the eastern contour of landslide B should be moved further east and, maybe, the northern contour of landslide A should be moved further north to take account of settlement direction of the buildings 6 and 15;
- the western contour of landslide G should be moved further west to take account of settlement direction of the building 10.

Some further considerations are necessary about the area where the buildings 1-9 and 13 are located. The fact that in this area damages due to foundation settlements are evident in buildings built in different periods with different structural conception can be due either to the presence of a landslide not indicated in the chart or to a significantly different contour of the landslide body B.

CONCLUSIONS

This article introduces a new multi-level approach to landslide vulnerability assessment and, in this framework, it focuses on the *Steps* involving the landslide damage assessment, to both R.C. and masonry structures, at the urban scale. Although tested for slow landslides, the new methodology here presented is also applicable to other landslide conditions/activities.

Differently from what commonly found in the literature, the methodology, although dealing with the urban scale, is fully deterministic and comes out from the multidisciplinary coupling between the knowledge of structural damage mechanics and landslide geomechanics. The landslide damage geotechnical chart, that is the end-product of the application of the methodology, does not only show the level of damage to buildings but, for each building, it can include: (i) the damage grade, (ii) the identification of the possible causes of damage and (iii) the settlement direction (both reconstructed through the diagnosis of the crack patterns carried out by means of the Load Path Method), (iv) the profile of the landslide body as the outcome of both geomorphological and geotechnical studies.

The validation of the methodology within a pilot site in the south of Italy has shown that the landslide damage geotechnical chart can represent a powerful tool to detect and monitor landsliding at the urban scale even in areas where, due to urbanization, geomorphological studies are not sufficient for tracing the contours of the landslide bodies.

ACKNOWLEDGMENTS

The research was carried out with the support from Apulia Region (PS_119), Italian Ministry for Research and University (PRIN 2007, 2015), COST Action TU1202.

REFERENCES

625 Alexander, D. (1986). “Landslide damage to buildings.” *Environ. Geol. Water Sci.*, 8 (3),
626 147·151.
627 Boscardin, M.D., Cording, E.G. (1989). “Building response to excavation induced
628 settlement.” *Journal of Geotechnical Engineering*, 115 (1), 1-21.
629 Burland, J.B. (1997). “Assessment of risk of damage to buildings due to tunnelling and
630 excavation.” *Earthquake Geotechnical Engineering*, 3,1189-1201.
631 Burland, J.B., Broms, B.B., de Mello, V.F.B. (1977). “Behaviour of foundations and
632 Structures.” *Proc. 9th Int. Conf. on Soil Mech. and Found.*, Tokyo, Japan.
633 Cafaro, F., Cotecchia, F., Santaloia, F., Vitone, C., Lollino, P., Mitaritonna G. (2017).
634 “Landslide hazard assessment and judgment of reliability: A geomechanical approach.”
635 *Bulletin of Engineering Geology and the Environment,* 76 (2), 397-412.
636 Cardinali, M., Reichenbach, P., Guzzetti, F., Ardizzone, F., Antonini, G., Galli, M., Cacciano,
637 M., Castellani, M., Salvati, P. (2002). “A geomorphological approach to the estimation of
638 landslide hazards and risks in Umbria, Central Italy” *Natural Hazards and Earth System*
639 *Sciences*, 2 (1-2), 57–72.
640 Cascini, L. (2008). “Applicability of landslide susceptibility and hazard zoning at different
641 scales.” *Engineering Geology*, 102 (3-4), 164–177.
642 Ciampalini, A., Bardi, F., Bianchini, S., Frodella, W., del Ventisette, C., Moretti, S., Casagli,
643 N. (2014). “Analysis of building deformation in landslide area using mulisensor PSInSAR
644 technique.” *International Journal of Applied Earth Observation and Geoinformation*, 33,
645 166-180.
646 Cooper, A.H. (2008). “The classification, recording, databasing and use of information about
647 building damage caused by subsidence and landslides.” *Quarterly Journal of Engineering*
648 *Geology and Hydrogeology,* 41, 409–424.
649 Cotecchia, F., Pedone, G., Bottiglieri, O., Santaloia, F., Vitone, C. (2014). “Slope–atmosphere

650 interaction in a tectonized clayey slope: a case study." *Italian Geotechnical Journal*, 48
651 (1), 34-61
652 Cotecchia, F., Vitone, C., Santaloia, F., Pedone, G., Bottiglieri O (2015). "Slope instability
653 processes in intensely fissured clays: case histories in the Southern Apennines."
654 *Landslides*, 12(5), 877-893.
655 Cotecchia, F., Santaloia, F., Lollino, P., Vitone, C., Pedone, G., Bottiglieri, O. (2016). "From
656 a phenomenological to a geo-mechanical approach to landslide hazard analysis." *European*
657 *Journal of Environmental and Civil Engineering (EJECE)*, 20 (9), 1004-1031
658 Cruden, D.M., Varnes, D.J. (1996). "Landslide Types and Processes." In Turner A.K. &
659 Schuster R.L. (eds.) *Landslide - Investigation and Mitigation*, Transp. Res. Board, Spec.
660 Rep. 247, Nat. Res. Co., USA, 36-75.
661 DPC (Presidenza del Consiglio dei Ministri. Dipartimento della Protezione Civile) (2009).
662 "Manuale per la compilazione della scheda di 1° livello di rilevamento danno, pronto
663 intervento e agibilità per edifici ordinari nell'emergenza post-sismica (AeDES)." Editrice
664 Italiani nel Mondo S.r.l., Rome, Italy (in Italian).
665 Grüntal, G. (1998). *European Macroseismic Scale 1998*, Centre Européen de Géodynamique
666 et de Séismologie, Luxembourg.
667 Hungr, O., Leroueil, S., Picarelli, L. (2014). "The Varnes classification of landslide types, an
668 update." *Landslides*, 11, 167-194.
669 Leone, F., Asté, J.P., Leroi, E. (1996). "Vulnerability assessment of elements exposed to
670 mass-movement: Working toward a better risk perception." In Senneset K (ed.) *Landslides*,
671 Balkema, Rotterdam, The Netherlands, 263-270.
672 Liu, X.L., Yue, Z.Q., Tham, L.G., Lee, C.F. (2002). "Empirical Assessment of Debris Flow
673 Risk on a Regional Scale in Yunnan Province, Southwestern China." *Environmental*
674 *Management*, 30 (2), 249-264.

675 Nardelli, V., Coop, M.R., Vitone, C., Chen, S. (2016). “The inter-scale behaviour of two
676 natural scaly clays.” *Géotechnique Letters*, 6, 205-210.
677 Palmisano. F. (2011). “Landslide structural vulnerability of masonry buildings.” PhD
678 Dissertation, Politecnico di Bari, Italy.
679 Palmisano, F. (2014). “Assessment of masonry arches and domes by simple models.”
680 *International Journal of Structural Engineering*, 5(1), 63-75.
681 Palmisano, F. (2016a). “Methodology for rapid structural vulnerability assessment for service
682 loads at the territorial scale.” *Journal of Performance of Constructed Facilities*, 30 (4),
683 04015079.
684 Palmisano, F. (2016b). “Rapid diagnosis of crack patterns of masonry buildings subjected to
685 landslide-induced settlements by using the Load Path Method.” *International Journal of*
686 *Architectural Heritage: Conservation, Analysis, and Restoration*, 10(4), 438-456.
687 Palmisano, F., Elia, A. (2013). “Analysis of the structural behaviour of masonry buildings
688 subjected to landslide by using the Load Path Method.” *International Journal of Earth*
689 *Sciences and Engineering*, 6(1), 39-49.
690 Palmisano, F., Elia, A. (2015). “Shape optimization of strut-and-tie models in masonry
691 buildings subjected to landslide-induced settlements.” *Engineering Structures*, 84, 223-
692 232.
693 Peduto, D., Nicodemo, G., Maccabiani, J., Ferlisi, S. (2017a). “Multi-scale analysis of
694 settlement-induced building damage using damage surveys and DInSAR data: A case
695 study in The Netherlands.” *Engineering Geology*, 218, 117–133.
696 Peduto D., Ferlisi S., Nicodemo G., Reale D., Pisciotta G., Gullà G. (2017b) “Empirical
697 fragility and vulnerability curves for buildings exposed to slow-moving landslides at
698 medium and large scales.” *Landslides*, in press, DOI : 10.1007/s10346-017-0826-7,
699 available online.

Petley, D. (2012). “Global patterns of loss of life from landslides.” *Geology*, 40, 927–930.

Ritter, W. (1899). “Die Bauweise Hennebique.” *Schweizerische Bauzeitung*, 7 (33), 59-61 (in German).

Roca, P., Viviescas, A., Lobato, M., Díaz, C., Serra, I. (2011). “Capacity of Shear Walls by Simple Equilibrium Models.” *International Journal of Architectural Heritage*, 5(4-5), 412-435.

Schlaich, J., Schafer, K., Jennewein, M. (1987). “Toward a consistent design of structural concrete.” *PCI Journal*, 32(3), 74-150.

Silvestri, F., Vitone, C., d’Onofrio, A., Cotecchia, F., Puglia, R., Santucci De Magistris, F. (2007). “The influence of meso-structure on the mechanical behaviour of a marly clay from low to high strains.” In *Soil Stress-Strain Behaviour: Measurement, modelling and analysis* (Ling. et al. eds.), Springer, The Netherlands, 333-350.

Terwel, K. (2017). “Should we focus on human or organizational factors?” *Proc. IABSE Workshop 2017: Ignorance, Uncertainty and Human Errors in Structural Engineering*, Helsinki, Finland.

Terwel, K., Jansen, S.J.Y. (2015). “Critical factors for structural safety in the design and construction phase.” *Journal of Performance of Constructed Facilities*, 29 (3), 4014068.

UNDRO (United Nations Disaster Relief Organisation) (1979). *Natural Disasters and Vulnerability Analysis*, Report of Expert Group Meeting (9-12 July 1979), Geneva.

Uzielli, M., Catani, F., Tofani, V., Casagli, N. (2015). “Risk analysis for the Ancona landslide—II: estimation of risk to buildings.” *Landslides*,12, 83–100

Vitone, C., Cotecchia, F. (2011). “The influence of intense fissuring on the mechanical behaviour of clays.” *Geotéchnique*, 61(12), 1003-1018.

Vitone, C., Cotecchia, F., Viggiani, G., Hall, S.A. (2013a). “Strain fields and mechanical response of a highly fissured bentonite clay.” *International Journal for Numerical and*

Analytical Methods in Geomechanics, 37 (11), 1510-1534.

Vitone, C., Viggiani, G., Cotecchia, F., Hall, S.A. (2013b). "Localized deformation in intensely fissured clays studied by 2D digital image correlation." *Acta Geotechnica*, 8, 247-263.

FIGURE CAPTIONS

Figure 1. Approach proposed by Palmisano (2011) for the *Level 1* landslide vulnerability assessment of structures.

Figure 2. Typical damages to buildings subjected to foundation settlements. (a)-(h): masonry buildings. (i) masonry and R.C. buildings. (l), (m): R.C. buildings. $\Delta i,j$: differential settlement between nodes *i* and *j* at the origin of the crack pattern.

Figure 3. Comparison of the proposed classification with those by Burland et al. (1977) and Grüntal (1998).

Figure 4. Proposed damage classification.

Figure 5. Geological and geomorphological map of Bovino. 1) Debris, 2) Sinthem of Bovino, 3) Toppo Capuana marls, 4) Faeto Flysch (a: clayey strata), 5) geological contact (a: stratigraphic, b: tectonic), 6) landslide (a: crown, b: body), 7) continuously cored boreholes (PS_119; a: inclinometers, b: piezometers); b) inclinometer readings along borehole I2.

Figure 6. Landslide damage geotechnical chart of Bovino.

Figure 7. Some typical damages due to foundation settlements observed in Bovino (for the building numbers refer to Fig. 6).

Figure 1

Click here to download Figure Fig.1 rel.05.tif

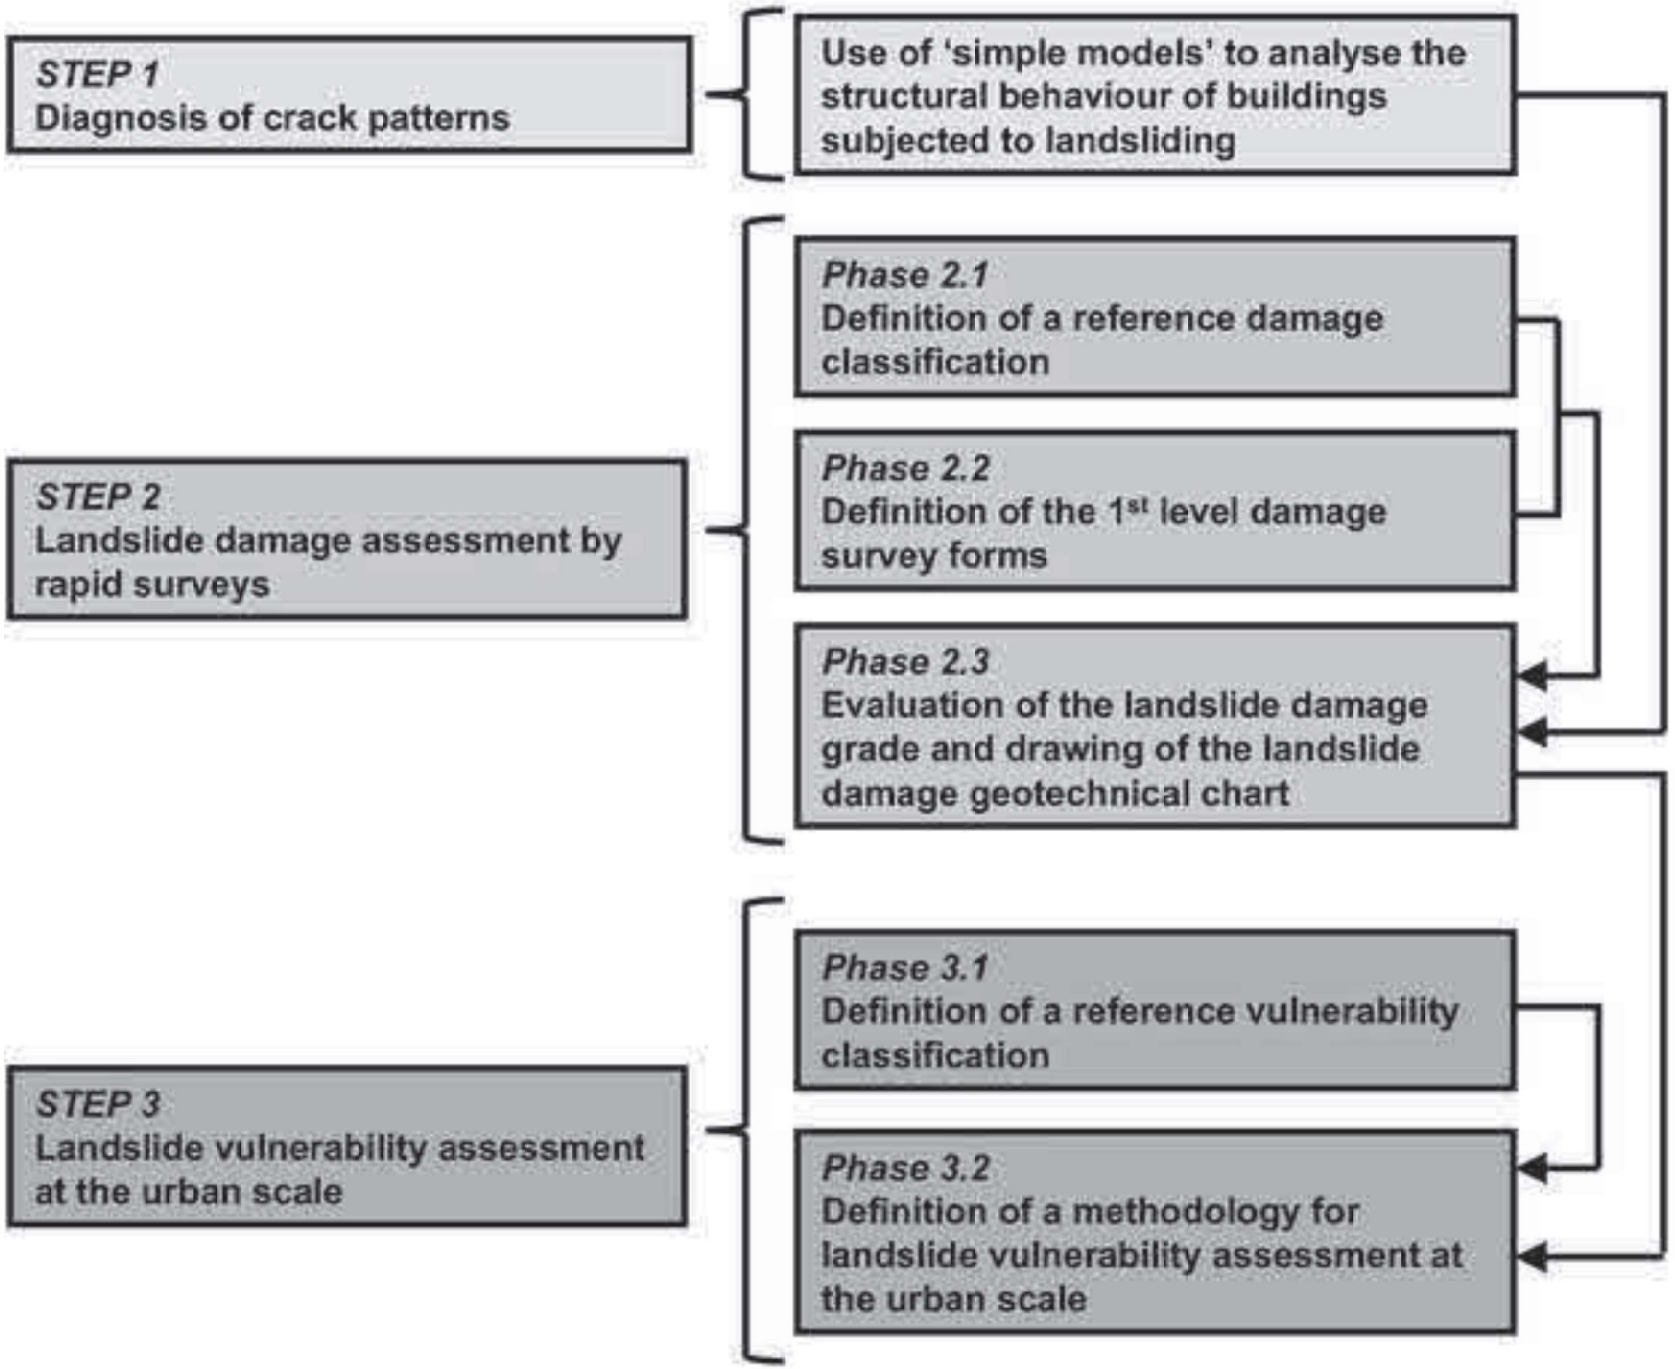


Figure 2

Click here to download Figure Fig.2 rel.02.tif

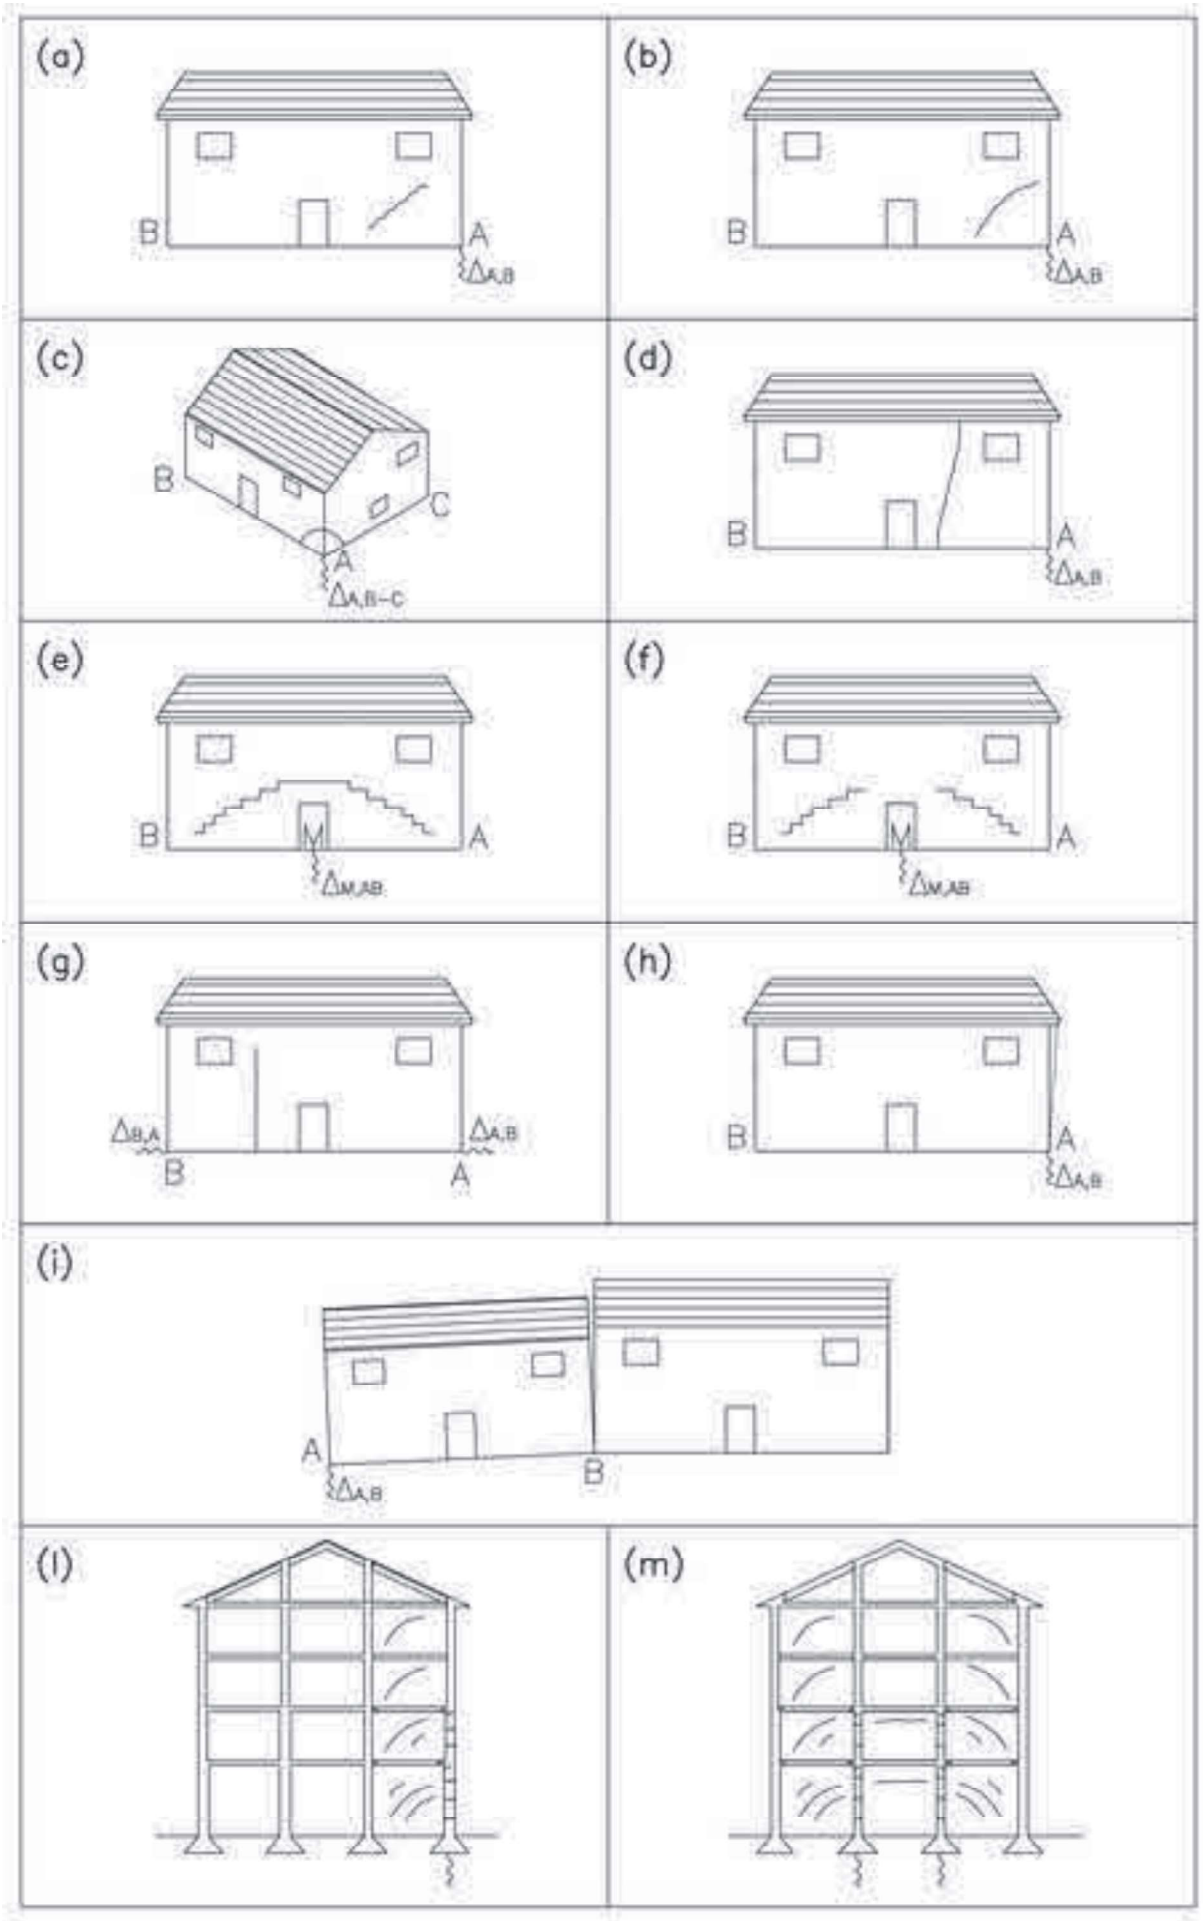


Figure 3

Click here to download Figure Fig.3.tif

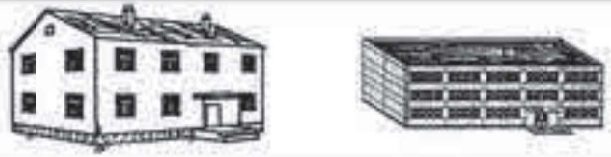
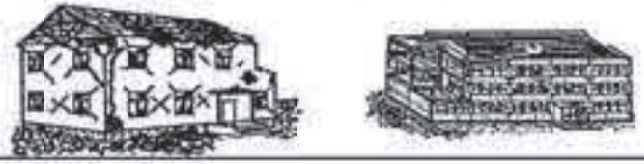
Burland et al. (1977) Classification		EMS 98 Classification (Grüntal 1998)		Proposed Classification	
0	Negligible			0	Negligible damage
1	Very slight	1		1	Negligible to slight damage
2	Slight	2		2	Moderate damage
3	Moderate				
4	Severe	3		3a	Substantial to heavy damage
		4		3b	Very heavy damage
5	Very severe	5		3c	Destruction

Figure 4

Click here to download Figure Fig.4 rel.04.tif

LEVEL OF DAMAGE

Level of damage	Description
0	No damage; crack width in masonry elements ≤ 0.1 mm; crack width in R.C. beams and floors ≤ 0.3 mm; crack width in R.C. columns, walls, nodes ≤ 0.3 mm; out of plumb of vertical elements ≤ 0.1%; reduction of steel bar diameter due to oxidation ≤ 5% of the nominal diameter.
1	Crack width in masonry elements > 0.1 mm and ≤ 1 mm; crack width in R.C. beams and floors > 0.3 mm and ≤ 1 mm; crack width in R.C. columns, walls, nodes > 0.3 mm and ≤ 0.5 mm; out of plumb of vertical elements > 0.1% and ≤ 0.2%; reduction of steel bar diameter due to oxidation > 5% and ≤ 10% of the nominal diameter.
2	Crack width in masonry elements > 1 mm ≤ 5 mm; crack width in R.C. beams and floors > 1 mm and ≤ 4 mm; crack width in R.C. columns, walls, nodes > 0.5 mm and ≤ 2 mm; out of plumb of vertical elements > 0.2% and ≤ 1%; reduction of steel bar diameter due to oxidation > 10% and ≤ 20% of the nominal diameter.
3	Crack width in masonry elements > 5 mm; crack width in R.C. beams and floors > 4 mm; crack width in R.C. columns, walls, nodes > 2 mm; out of plumb of vertical elements > 1%; reduction of steel bar diameter due to oxidation > 20% of the nominal diameter.

+

EXTENSION OF DAMAGE

Extension of damage	Description
few	Not more than 1/3 of the elements are damaged.
many	More than 1/3 and not more than 2/3 of the elements are damaged.
most	More than 2/3 of the elements are damaged.

DAMAGE GRADES

Grade of damage	Description of grade of damage for masonry buildings	Description of grade of damage for R.C. buildings
0	*Negligible damage* Damage of level 0 or damage of level 1 in few elements.	*Negligible damage* Damage of level 0 or damage of level 1 in few elements.
1	*Slight damage* Damage of level 1 in many elements or damage of level 2 in few elements or fall of small pieces of plaster only or fall of loose stones from upper parts of buildings in few cases.	*Slight damage* Damage of level 1 in many elements or damage of level 2 in few elements.
2	*Moderate damage* Damage of level 1 in most elements or damage of level 2 in many elements or damage of level 3 in few elements or fall of fairly large pieces of plaster.	*Moderate damage* Damage of level 1 in most elements or damage of level 2 in many elements or damage of level 3 in few elements or fall of brittle cladding and plaster or falling mortar from the joints of wall panels.
3a	*Heavy damage* Damage of level 2 in most elements or damage of level 3 in many elements or failure of individual non-structural elements (partition walls).	*Heavy damage* Damage of level 2 in most elements or damage of level 3 in many elements or spalling of concrete cover due to buckling of reinforced bars.
3b	*Very heavy damage* Damage of level 3 in most elements or serious failure of walls or partial structural failure of roofs and floors.	*Very heavy damage* Damage of level 3 in most elements or cracks in R.C. elements with compression failure of concrete or fracture of bars or bond failure of beam reinforced bars or tilting of columns or collapse of a few columns or collapse of a single upper floor.
3c	*Destruction* Total or near total collapse.	*Destruction* Collapse of ground floor or parts (e.g. wings, floors) of buildings.

Figure 5

Click here to download Figure Fig.5.tif

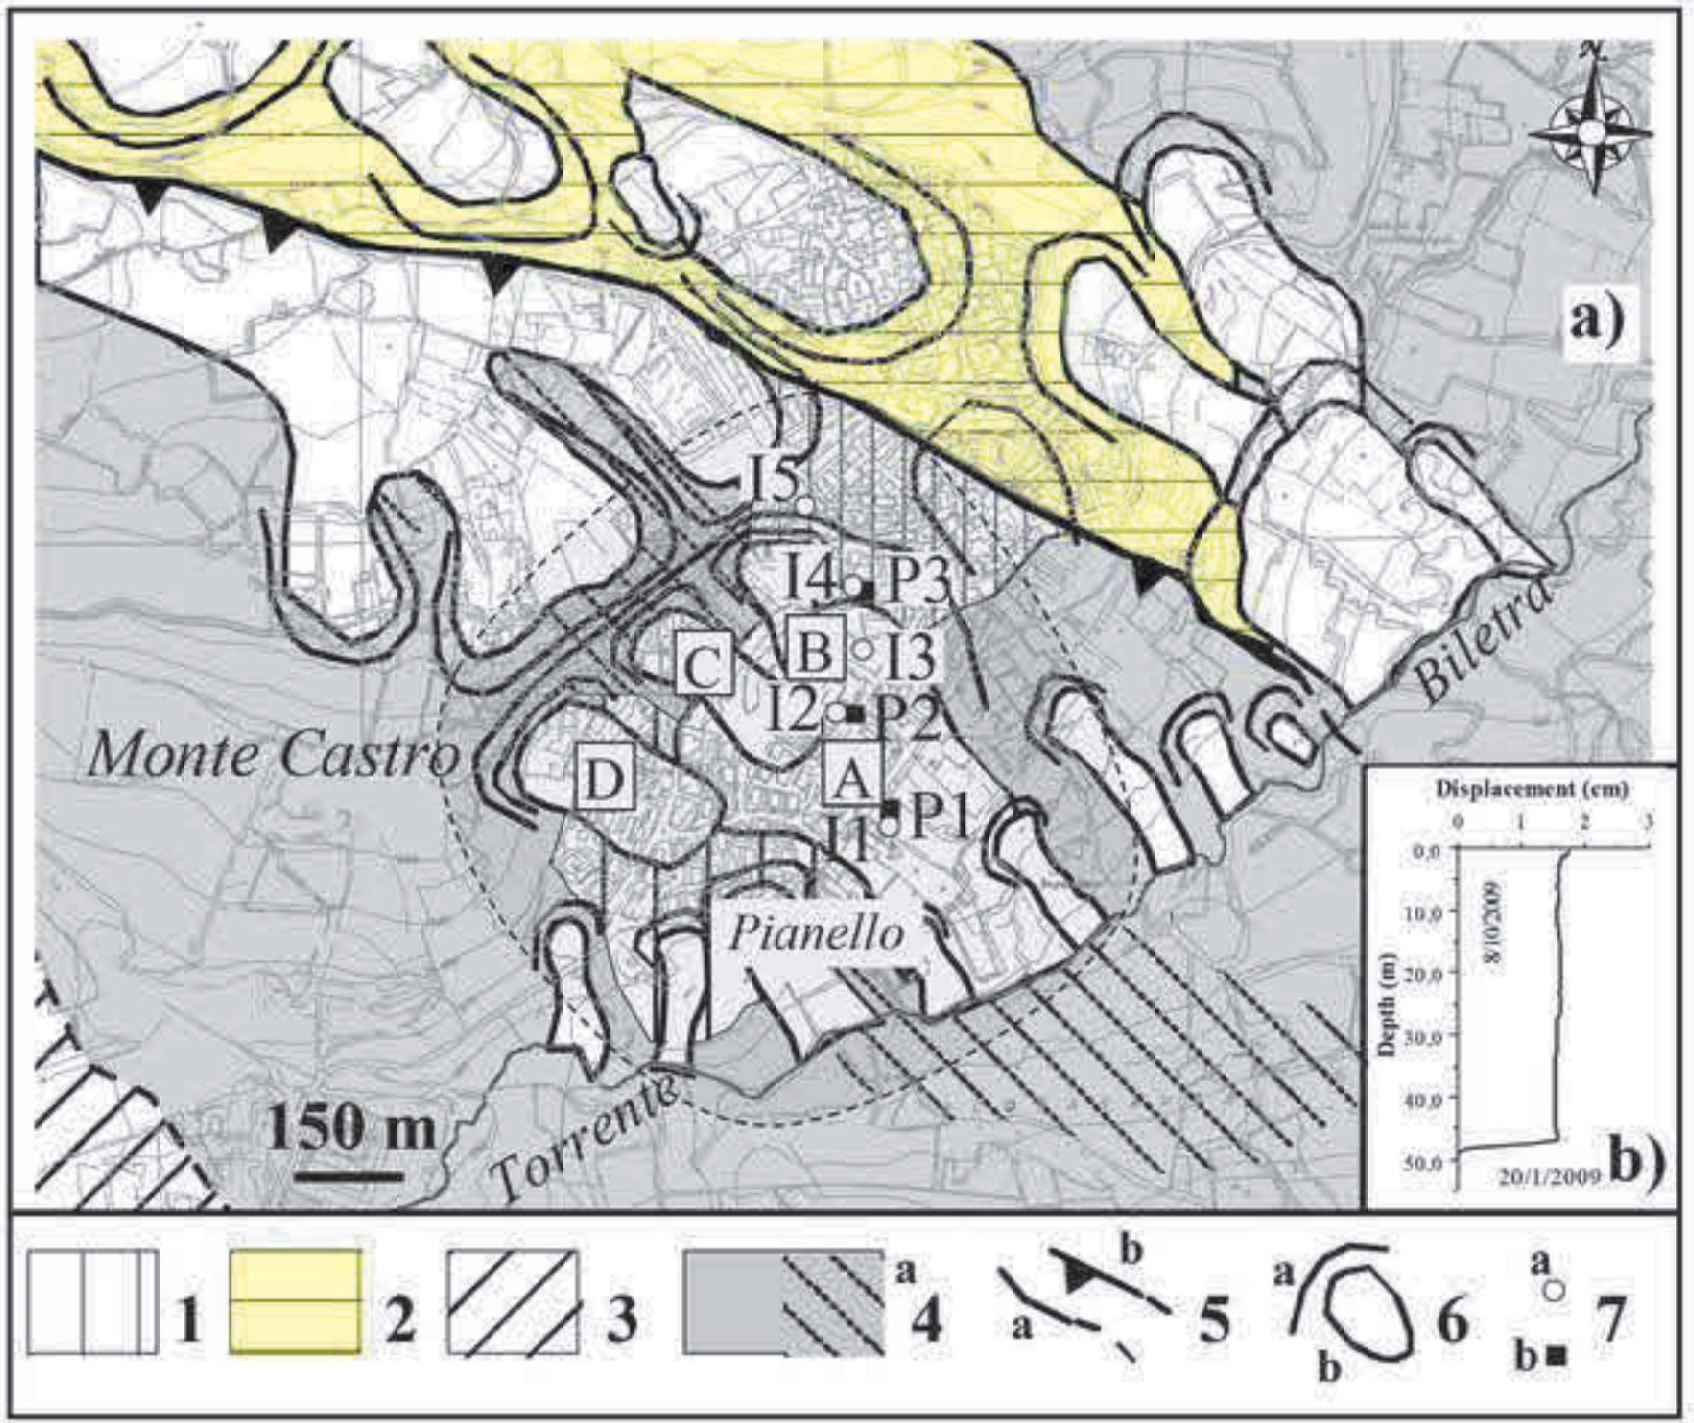


Figure 6

Click here to download Figure Fig.6 rel.03.tif

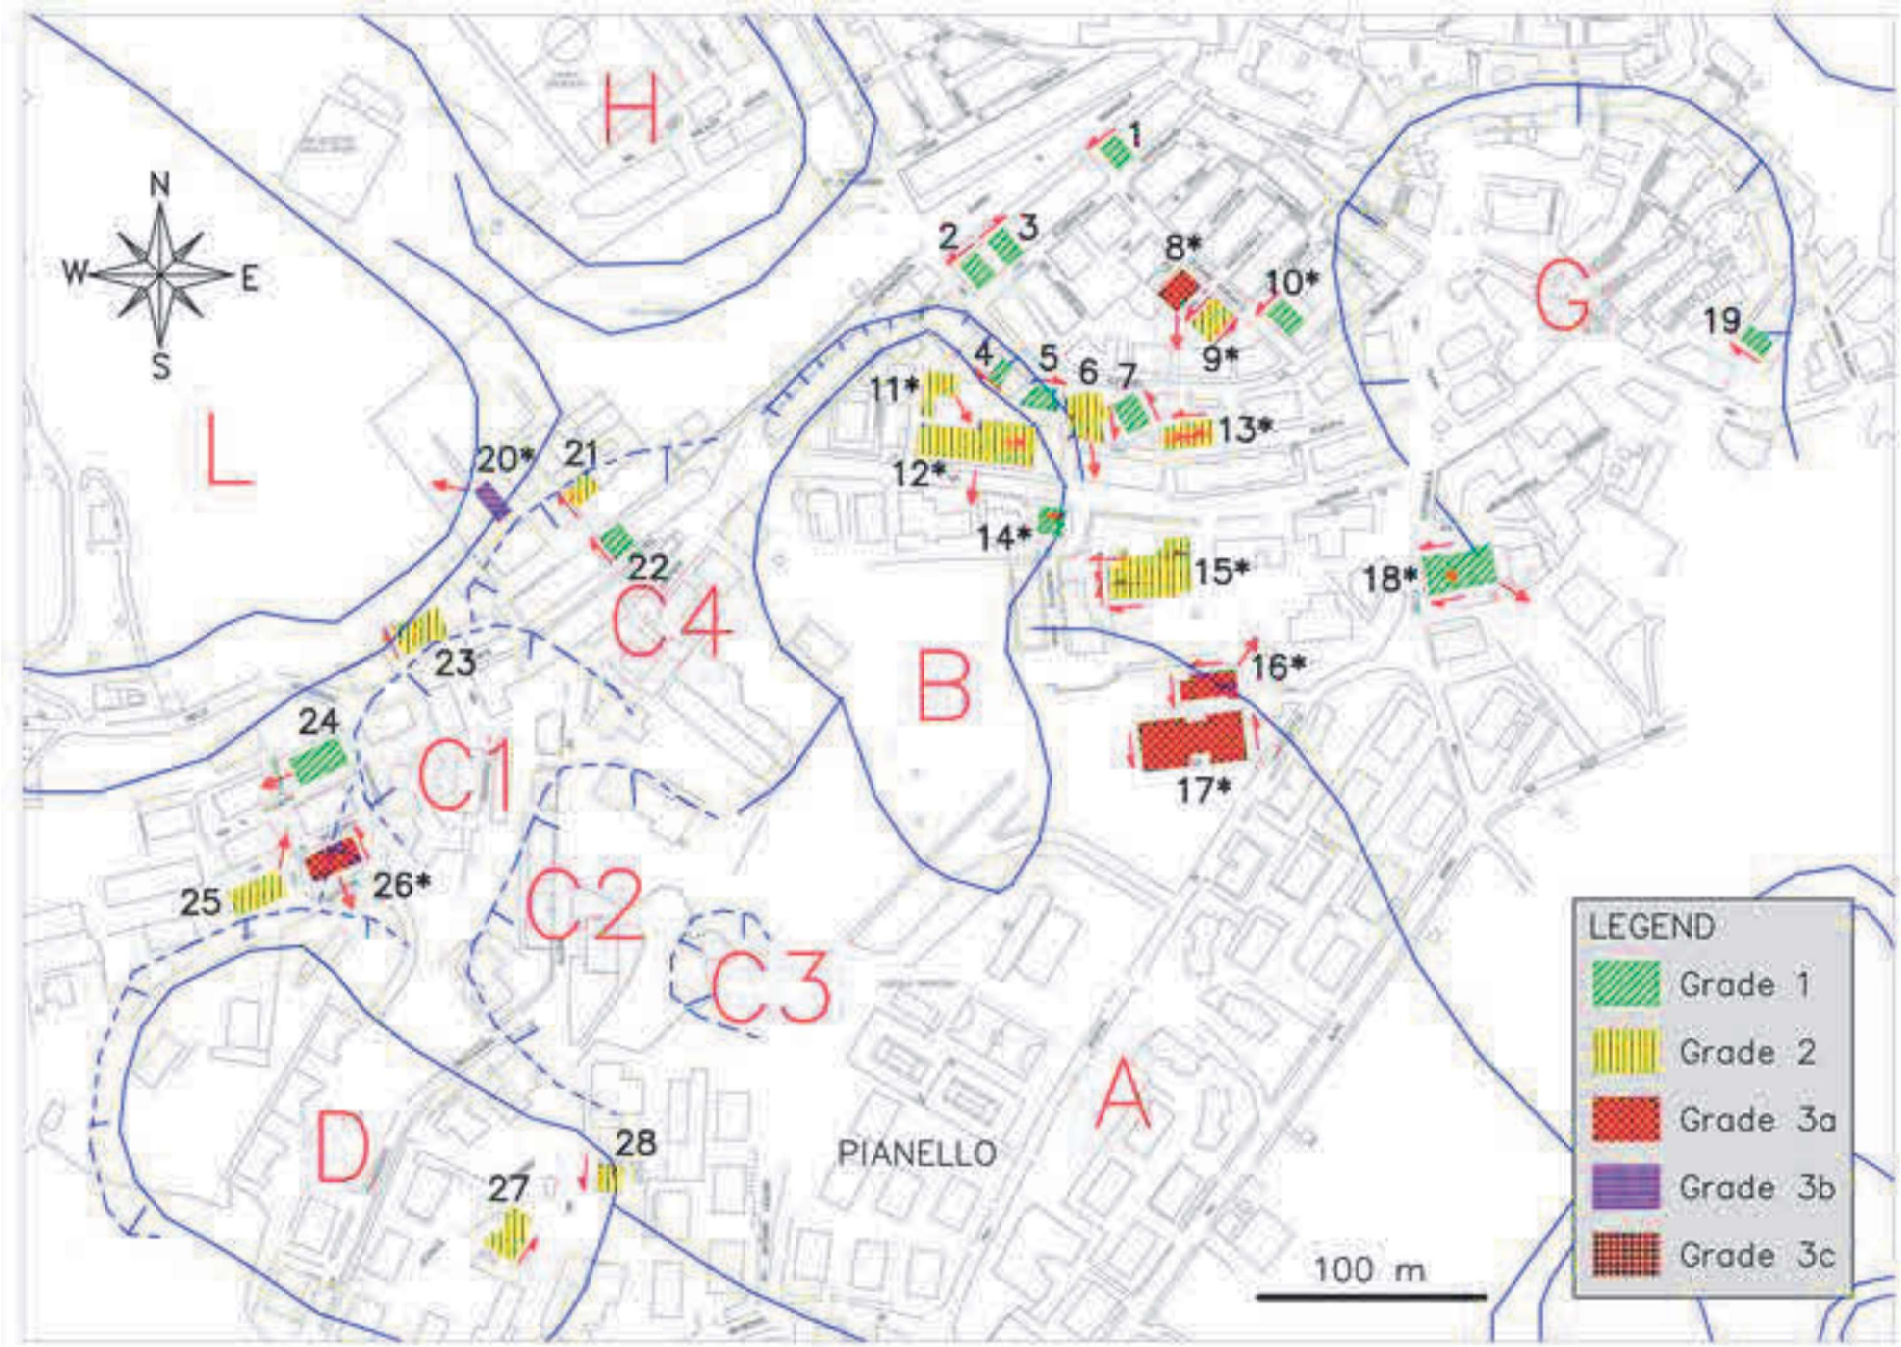


Figure 7

Click here to download Figure Fig.7 rel.02.tif



building (6): masonry structure

building (8): masonry structure

building (11): R.C. structure

building (13): R.C. structure

building (17): R.C. structure

building (26): masonry structure

Supplemental Data File 1 (to be included in the electronic version of the article)




Click here to access/download

Supplemental Data File

SD1. Masonry form rel.04.pdf

Supplemental Data File 2 (to be included in the electronic version of the article)

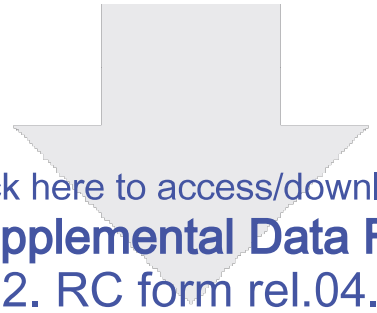

Click here to access/download

Supplemental Data File

SD2. RC form rel.04.pdf

Supplemental Data File 3 (to be included in the electronic version of the article)

Click here to access/download
Supplemental Data File
SD3. Crack pattern legend.pdf

Supplemental Data File 4 (to be included in the electronic version of the article)

Click here to access/download
Supplemental Data File
SD4. Settlement typologies rel.02.pdf

Copyright Agreement

Click here to download Copyright Agreement ASCE JPCF 2017a signed copyright .pdf

ASCE Authorship, Originality, and Copyright Transfer Agreement

Publication Title: Journal of performance of constructed facilities

Manuscript Title: ASSESSMENT OF LANDSLIDE DAMAGE TO BUILDINGS AT THE URBAN SCALE

Author(s) – **Names, postal addresses, and e-mail addresses of all authors**

Fabrizio Palmisano, DICAR, Politecnico di Bari, Via Orabona 4, 70125, Bari, Italy, fabrizio.palmisano@poliba.it

Claudia Vitone, DICATECh, Politecnico di Bari, Via Orabona 4, 70125, Bari, Italy, claudia.vitone@poliba.it

Federica Cotecchia, DICATECh, Politecnico di Bari, Via Orabona 4, 70125, Bari, Italy, federica.cotecchia@poliba.it

I. Authorship Responsibility

To protect the integrity of authorship, only people who have significantly contributed to the research or project and manuscript preparation shall be listed as coauthors. The corresponding author attests to the fact that anyone named as a coauthor has seen the final version of the manuscript and has agreed to its submission for publication. Deceased persons who meet the criteria for coauthorship shall be included, with a footnote reporting date of death. No fictitious name shall be given as an author or coauthor. An author who submits a manuscript for publication accepts responsibility for having properly included all, and only, qualified coauthors.

I, the corresponding author, confirm that the authors listed on the manuscript are aware of their authorship status and qualify to be authors on the manuscript according to the guidelines above.

Fabrizio Palmisano — Nov. 2, 2017

Print Name — Signature — Date

II. Originality of Content

ASCE respects the copyright ownership of other publishers. ASCE requires authors to obtain permission from the copyright holder to reproduce any material that (1) they did not create themselves and/or (2) has been previously published, to include the authors' own work for which copyright was transferred to an entity other than ASCE. Each author has a responsibility to identify materials that require permission by including a citation in the figure or table caption or in extracted text. Materials re-used from an open access repository or in the public domain must still include a citation and URL, if applicable. At the time of submission, authors must provide verification that the copyright owner will permit re-use by a commercial publisher in print and electronic forms with worldwide distribution. For Conference Proceeding manuscripts submitted through the ASCE online submission system, authors are asked to verify that they have permission to re-use content where applicable. Written permissions are not required at submission but must be provided to ASCE if requested. Regardless of acceptance, no manuscript or part of a manuscript will be published by ASCE without proper verification of all necessary permissions to re-use. ASCE accepts no responsibility for verifying permissions provided by the author. Any breach of copyright will result in retraction of the published manuscript.

I, the corresponding author, confirm that all of the content, figures (drawings, charts, photographs, etc.), and tables in the submitted work are either original work created by the authors listed on the manuscript or work for which permission to re-use has been obtained from the creator. For any figures, tables, or text blocks exceeding 100 words from a journal article or 500 words from a book, written permission from the copyright holder has been obtained and supplied with the submission.

Fabrizio Palmisano — Nov. 2, 2017

Print name — Signature — Date

III. Copyright Transfer

ASCE requires that authors or their agents assign copyright to ASCE for all original content published by ASCE. The author(s) warrant(s) that the above-cited manuscript is the original work of the author(s) and has never been published in its present form.

The undersigned, with the consent of all authors, hereby transfers, to the extent that there is copyright to be transferred, the exclusive copyright interest in the above-cited manuscript (subsequently called the "work") in this and all subsequent editions of the work (to include closures and errata), and in derivatives, translations, or ancillaries, in English and in foreign translations, in all formats and media of expression now known or later developed, including electronic, to the American Society of Civil Engineers subject to the following:

- The undersigned author and all coauthors retain the right to revise, adapt, prepare derivative works, present orally, or distribute the work, provided that all such use is for the personal noncommercial benefit of the author(s) and is consistent with any prior contractual agreement between the undersigned and/or coauthors and their employer(s).
- No proprietary right other than copyright is claimed by ASCE.
- If the manuscript is not accepted for publication by ASCE or is withdrawn by the author prior to publication (online or in print), this transfer will be null and void.
- Authors may post a PDF of the ASCE-published version of their work on their employers' ***Intranet*** with password protection. The following statement must appear with the work: "This material may be downloaded for personal use only. Any other use requires prior permission of the American Society of Civil Engineers."
- Authors may post the ***final draft*** of their work on open, unrestricted Internet sites or deposit it in an institutional repository when the draft contains a link to the published version at www.ascelibrary.org. "Final draft" means the version submitted to ASCE after peer review and prior to copyediting or other ASCE production activities; it does not include the copyedited version, the page proof, a PDF, or full-text HTML of the published version.

Exceptions to the Copyright Transfer policy exist in the following circumstances. Check the appropriate box below to indicate whether you are claiming an exception:

☐ **U.S. GOVERNMENT EMPLOYEES:** Work prepared by U.S. Government employees in their official capacities is not subject to copyright in the United States. Such authors must place their work in the public domain, meaning that it can be freely copied, republished, or redistributed. In order for the work to be placed in the public domain, ALL AUTHORS must be official U.S. Government employees. If at least one author is not a U.S. Government employee, copyright must be transferred to ASCE by that author.

☐ **CROWN GOVERNMENT COPYRIGHT:** Whereby a work is prepared by officers of the Crown Government in their official capacities, the Crown Government reserves its own copyright under national law. If ALL AUTHORS on the manuscript are Crown Government employees, copyright cannot be transferred to ASCE; however, ASCE is given the following nonexclusive rights: (1) to use, print, and/or publish in any language and any format, print and electronic, the above-mentioned work or any part thereof, provided that the name of the author and the Crown Government affiliation is clearly indicated; (2) to grant the same rights to others to print or publish the work; and (3) to collect royalty fees. ALL AUTHORS must be official Crown Government employees in order to claim this exemption in its entirety. If at least one author is not a Crown Government employee, copyright must be transferred to ASCE by that author.

☐ **WORK-FOR-HIRE:** Privately employed authors who have prepared works in their official capacity as employees must also transfer copyright to ASCE; however, their employer retains the rights to revise, adapt, prepare derivative works, publish, reprint, reproduce, and distribute the work provided that such use is for the promotion of its business enterprise and does not imply the endorsement of ASCE. In this instance, an authorized agent from the authors' employer must sign the form below.

☐ **U.S. GOVERNMENT CONTRACTORS:** Work prepared by authors under a contract for the U.S. Government (e.g., U.S. Government labs) may or may not be subject to copyright transfer. Authors must refer to their contractor agreement. For works that qualify as U.S. Government works by a contractor, ASCE acknowledges that the U.S. Government retains a nonexclusive, paid-up, irrevocable, worldwide license to publish or reproduce this work for U.S. Government purposes only. This policy DOES NOT apply to work created with U.S. Government grants.

I, the corresponding author, acting with consent of all authors listed on the manuscript, hereby transfer copyright or claim exemption to transfer copyright of the work as indicated above to the American Society of Civil Engineers.

Fabrizio Palmisano

Print Name of Author or Agent



Signature of Author or Agent

Nov. 2, 2017

Date

More information regarding the policies of ASCE can be found at http://www.asce.org/authorsandeditors